
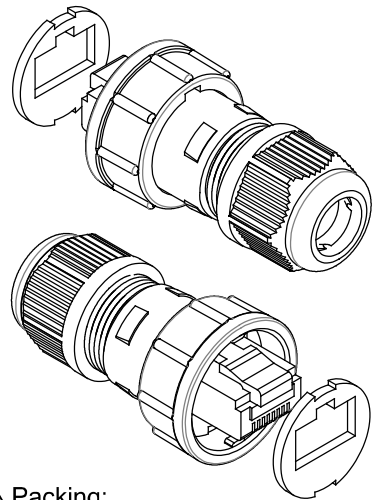



RoHS

REV.	DESCRIPTION	DATE
A	ISSUE	Apr/01/2014
B	Change gasket & packing way.	Apr/15/2020
note1	Correct dimension.	Aug/10/2022

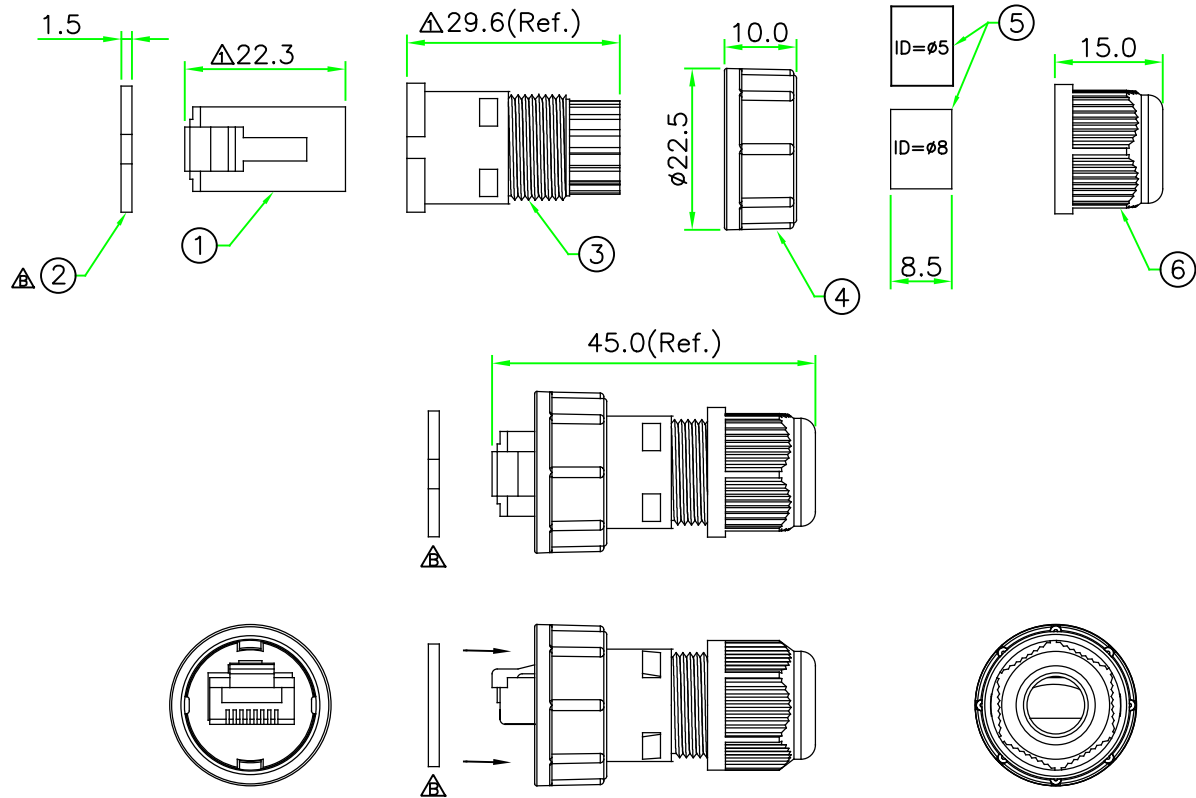

⚠ Packing:

#2 Zipper PE Bag.

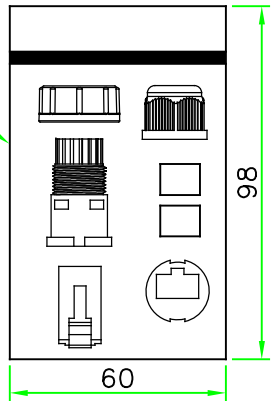

⚠ Notes:
Paste gasket up after RJ45 plug insert in position.
(RJ45 plug 插入後再黏貼上墊片)

原型號為 :RJ45C-L108SAS


HOLIN [®] HTP ASIA TECHNOLOGY CO., LTD. 禾凌科技股份有限公司					
		UNIT: mm	TITLE RJ45 PLUG C SIZE LOCK TYPE FIELD INSTALLABLE PLUG		
SCALE 1:1					
UNLESS OTHERWISE SPECIFIED TOLERANCES: XX. ± 0.5 .X ± 0.5 .XX ± 0.25 .XXX± 0.1 ANGLE ± 1° REV. B			P/N: RJ45C-L4SAS		DR. SIBYL
					CH. JAMES
			SHEET 1/2		DWG.NO: RJ45C-L4SAS

No.	PART NAME	DESCRIPTION	COLOR	Q'TY	REMARKS
6	SCREW	NYLON.	BLACK	1	70-135
5	SEAL	EPDM. for cable OD: 3~5mm & 5~8mm.	BLACK	2	71-135
4	SCREW NUT	SCREW NUT, NYLON+GF.	BLACK	1	
3	SLEEVE	CABLE SLEEVE, NYLON.	BLACK	1	69-135-N2
2	GASKET ⚠	NBR.	BLACK	1	GSL-1815-NK03
1	RJ-45 PLUG	RJ-45 8P8C SHIELDED PLUG.		1	

PROPRIETARY AND CONFIDENTIAL


Installation Guide of RJ45 C-size Field Attachable Connector | RJ45 C-size 組裝式安裝說明

Step 1: Pass the cable through the components 6.5.4.3 in sequence.
步驟 1: 將線材依序穿過部件 6, 5, 4, 3。

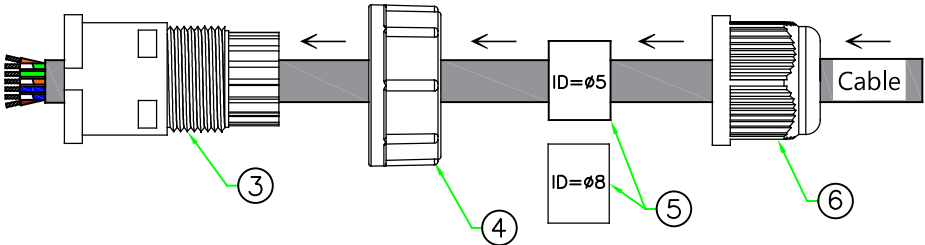


Suitable cable OD: 3~8mm.
適用線材OD: 3~8mm.


Step 2: Crimp the RJ45 plug onto the stripped cable, insert RJ45 plug into component 3.
步驟 2: 線材壓接RJ45後，將RJ45推回部件3。

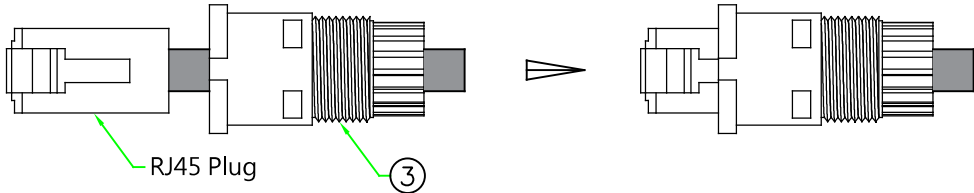

Step 3: Remove paper of adhesive of Gasket (component 2), stick the Gasket to the plane of the component 3
步驟 3: 撕去墊片之背膠膜後(部件2)，貼回連接器平面。

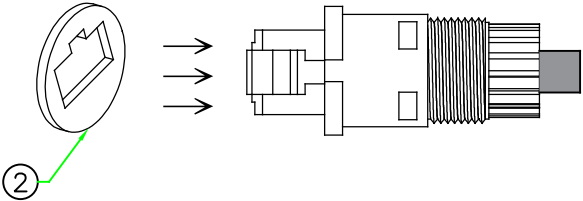

Step 4: Assemble components 4.5.6 in sequence.
步驟 4: 將部件4, 5, 6 依序組裝。

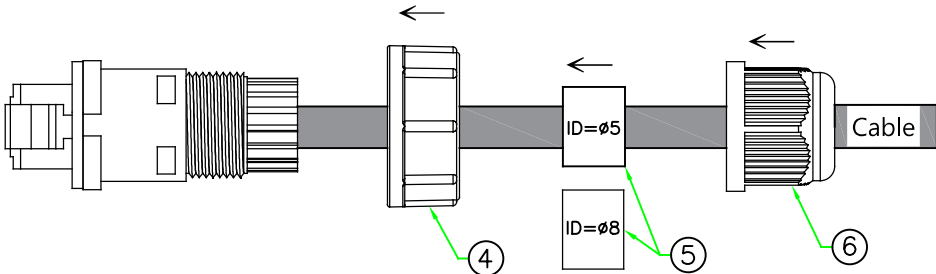

REV.	DESCRIPTION	DATE
A	ISSUE	Apr/01/2014
B	Change gasket & packing way.	Apr/15/2020
note1	Correct dimension.	Aug/10/2022

HOLIN® HTP ASIA TECHNOLOGY CO., LTD. 禾凌科技股份有限公司			
	UNIT: mm	TITLE RJ45 PLUG C SIZE LOCK TYPE FIELD INSTALLABLE PLUG	
SCALE	1:1		
UNLESS OTHERWISE SPECIFIED TOLERANCES: XX. ± 0.5 .X ± 0.5 .XX ± 0.25 .XXX± 0.1 ANGLE ± 1°		P/N: RJ45C-L4SAS	DR. SIBYL
			CH. JAMES
REV. B	SHEET 2/2	DWG.NO: RJ45C-L4SAS	AP.